Name: Blanchette, Audrey

Tonsido Increation

Y/M/M: 2014 Volkswagen Jetta

VIN:3VW2K7AJ4EM313556 License:HKF9602 TX Mileage:89821 Date Completed:In Progress

Test Drive	GYR		
Exterior condition	Minor damage		
Exterior Lights			
Interior condition	No major defects		
Wiper Blades/Washer			
Dash warning lamps			
Air Conditioning			
Heater			
Horn			
Test drive concerns			

Topside Inspection	GYR
Radiator	
Battery	
Leaks	
Topside concers	

Suspension/Steering	GYR
Front Suspension	 ✓
Rear Suspension	 ✓
Ball Joints	
Bushings	
Wheel Bearings	
Steering components	

Brakes	GYR
Front Pads/Rotors	
Rear Pads/Rotors	
Calipers	
Wheel Cylinders	
Lines and Hoses	✓

Maintenance	GYR
PCV Valve	
Timing Belt	
Spark Plugs	✓

lopside inspection	GYR
Engine dressings/ covers	
Coolant level condition	✓
Cabin air filter	
Oil level/ condition	✓
Brake Fluid level/ condition	✓
Power Steering Fluid level/	✓
condition	
Transmission Fluid	✓
level/condition	
Air Filter	✓
Cooling Fans	
Hoses	✓
Belt(s)	

Undercar	GYR	Tire Inspection	GYR
Power Steering Pump		TREAD	DEPTH
Oil Leaks		FRONT	
Steering Box/Rack		Left 6 / 32"	
Sway Bar Links		Right 6 / 32"	
C.V. Joints/ Axle		REAR	
Clutch Slave Cylinder		Left 5 / 32"	Image: A matrix and the second sec
Transfer Case Fluid		Right 5 / 32"	✓
Differential Fluid		5/32" or greater	4/32" 3/32" or less
Universal Joints		AIR PRESSURE	WEAR PATTERN
Fuel Filter		FRONT Before OEM spec	FRONT
Water Pump		Left 29 33	Left 🔽 📕
Exhaust		Right 30 33	Right
Undercar concerns		REAR ^{psi psi}	REAR
		Left 30 33	Left 📃 🖌 📃
		Right 30 33	Right 📃 🖌 📃
		psi psi	

Exterior condition Damage on rear right fender

Dash warning lamps No lights on

Coolant level condition

Coolant is full See history/Volkswagen intervals for recommended services

Cabin air filter Not equipped

Oil level/ condition Level is good but dirty

Brake Fluid level/ condition Level is good See history/Volkswagen intervals for recommended services

Power Steering Fluid level/ condition Level is good See history/Volkswagen intervals for recommended services

Transmission Fluid level/condition No transmission dipstick See history/Volkswagen intervals for recommended services

Air Filter Dirty

Hoses Soft

Battery Good 613 of 650 cca

Front Suspension Struts are OE

Rear Suspension Shocks are OE

Front Pads/Rotors

Left side pads measured 8 mm Right side pads measured inner 5 mm outer 3 mm Left rotor is 0.850 Right rotor is 0.853

Rear Pads/Rotors Left pads measured 6 mm Right pads measured 6-8 mm

PCV Valve See history/Volkswagen intervals for recommended services

Timing Belt See history/Volkswagen intervals for recommended services

Spark Plugs See history/Volkswagen intervals for recommended services

Oil Leaks No leaks visible at this time


Exterior condition:



Exterior condition:



Exterior condition:

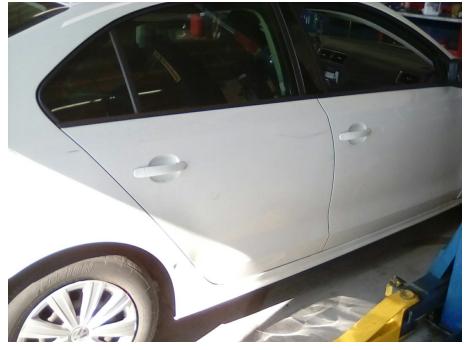

Exterior condition:



Exterior condition:



Exterior condition:



Dash warning lamps:



Engine dressings/ covers:



Oil level/ condition:



Air Filter:



Battery:



Front Pads/Rotors:



Page 10 of 14

Front Pads/Rotors:



Front Pads/Rotors:




Page 11 of 14

Front Pads/Rotors:




Rear Pads/Rotors:

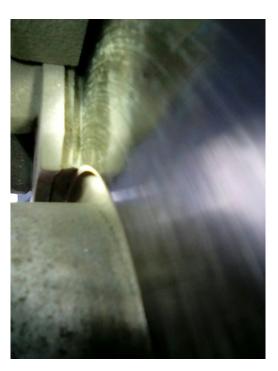


Rear Pads/Rotors:



Rear Pads/Rotors:

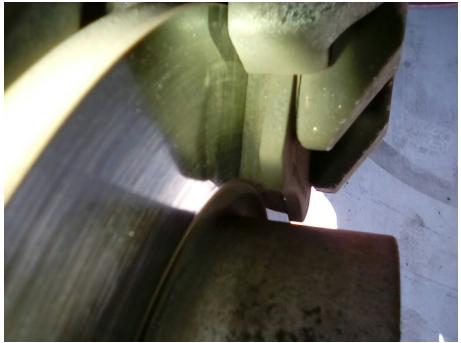

Rear Pads/Rotors:

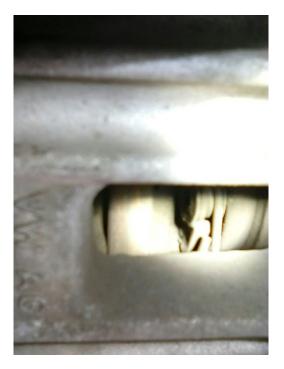

Oil Leaks:

